



Fisheries and Oceans  
Canada

Pêches et Océans  
Canada

Canadian  
Coast Guard

Garde côtière  
canadienne



VOL. 32, MONTHLY EDITION N° 12  
DECEMBER 28, 2007

Publication Number 40063779

# NOTICES TO MARINERS PUBLICATION EASTERN EDITION

Published monthly by the  
**CANADIAN COAST GUARD**

## CONTENTS

	Page
Section 1 Safety and General Information .....	1 - 5
Section 2 Chart Corrections.....	6 - 23
Section 3 Corrections to Radio Aids to Marine Navigation.....	24
Section 4 Sailing Directions and Small Craft Guide Corrections.....	25, 26
Section 5 List of Lights, Buoys and Fog signals Corrections .....	27 - 31

Maritime Services Directorate  
Aids to Navigation

Internet: [www.notmar.gc.ca](http://www.notmar.gc.ca)



## EXPLANATORY NOTES

**Geographical positions** refer directly to the graduations of the largest scale Canadian Hydrographic chart unless otherwise indicated.

**Bearings** refer to the true compass and are measured clockwise from 000° (North) clockwise to 359°; those relating to lights are from seaward.

**Visibility** of lights is that in clear weather.

**Depths** - The units used for soundings (metres, fathoms or feet) are stated in the title of each chart.

**Elevations** are normally given above Higher High Water, Large Tides unless otherwise indicated.

**Distances** may be calculated as follows:

1 nautical mile	= 1 852 metres (6,076.1 feet)
1 statute mile	= 1 609.3 metres (5,280 feet)
1 metre	= 3.28 feet

**Temporary & Preliminary Notices** are indicated by a (T) or a (P) before the chart action. Please note that Nautical charts are not hand amended by the Canadian Hydrographic Service for Temporary (T) and Preliminary (P) Notices. It is recommended that mariners chart these corrections in pencil. Listing of charts affected by Temporary and Preliminary Notices are revised and promulgated quarterly in Section 1 of the Monthly Edition.

**Please note that, in addition to the temporary and preliminary changes normally advertised as (T) and (P) Notices, there are a significant number of permanent changes to navigational aids that have been advertised as Preliminary Notices to Mariners while charts are being updated for new editions.**

**Marine Information Report & Suggestion Sheet** - Mariners are requested to notify the responsible authorities when new or suspected dangers to navigation are discovered, changes observed in aids to navigation or corrections to publications are seen to be necessary. Such communications can be made using the *Marine Information Report & Suggestion Sheet* inserted on the last page of each monthly edition of *Notices to Mariners*.


**Monthly edition of Notices to Mariners** - *Notices to Mariners* are issued free of charge on a monthly basis. Mariners now have a choice between specific *Regional* issue(s) they wish to receive. Requests to be placed on or removed from the mailing list should be made by using the form inserted on page vi of each monthly edition. Notification of changes to the mailing addresses, regional issues and/or number of copies required should also be transmitted by means of this form.

**Canadian Nautical Charts & Publications** - A source list of *Canadian Nautical Charts & publications* is published in *Notice No. 14* of the current *Annual Edition of Notices to Mariners*. The source supply and the prices effective at the time of printing are listed. This list is periodically updated in the monthly edition of *Notices to Mariners*.

**NOTE: Cette publication est aussi disponible en français.**

## CHART CORRECTIONS - SECTION 2

Corrections to nautical charts will be listed in numeric order by chart number. Each chart correction listed applies only to that particular chart. Related charts, if any, will have their own specific correction listed separately. Users should also refer to CHS Chart 1 Symbols, Abbreviations Terms for additional information pertaining to the correction of charts. The illustration below describes the elements that will comprise a typical Section 2 chart correction.

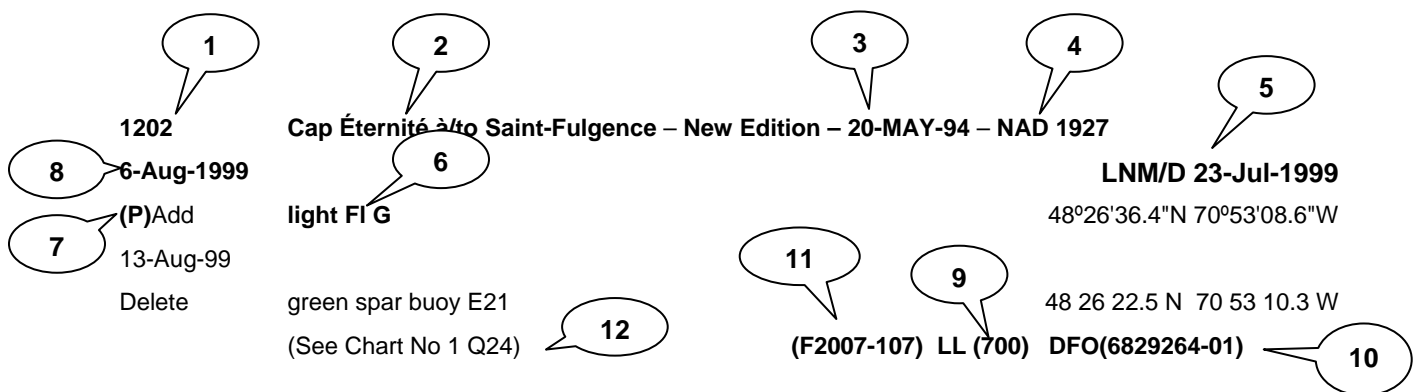

1 - Chart Number

2 - Chart Title

3 - Chart's latest New Edition date

4 - Horizontal Chart Datum

5 - Last Correction

6 - Chart action

7 - Notice type

8 - Weekly chart correction date

9 - List of light number

10 - CHS record reference number

11 - CCG Record reference number

12 - Chart No 1 reference number

The last correction number is identified with the **LNM/D** or **Last Notice to Mariners Number / Date**. This number is expressed in either old notice number format (ex.: 594/99) or in day-month-year format which is the date known as the weekly chart correction date shown in the above diagram as item (8).

## ADVISORY

### **NOTICES TO SHIPPING (WRITTEN AND BROADCAST)**

The Canadian Coast Guard is implementing a number of changes to the aids to navigation system in Canada.

These changes are advertised as Notices to Shipping (Broadcast and Written) by the Canadian Coast Guard and are followed up with Notices to Mariners, then charts are updated by hand correction, reprints or new editions.

Mariners are advised that all relevant Written Notices to Shipping should be kept until superseded by Notices to Mariners or through revised charts issued by the Canadian Hydrographic Service.

Written Notices to Shipping are published weekly and are available from local Canadian Coast Guard Offices.

The Canadian Hydrographic Service is reviewing the impact of these changes with the Canadian Coast Guard and together we are preparing an action plan on the issuing of chart revisions.

For further information contact your local Regional Notices to Shipping (Notships) issuing authorities.

#### **Newfoundland**

Fisheries and Oceans Canada,  
Canadian Coast Guard,  
St. John's MCTS Centre  
P.O. Box 5667  
ST JOHN'S NL A1C 5X1  
Telephone: 709 772-2083 / 2106  
Facsimile: 709 772-5369

#### **Quebec**

\* Fisheries and Oceans Canada,  
Canadian Coast Guard,  
Regional Operations Centre (ROC)  
101 Champlain Boulevard  
QUEBEC QC G1K 7Y7  
Telephone: 418 648-5410 / 4427  
Facsimile: 418 648-7244

#### **Maritimes**

\* Fisheries and Oceans Canada  
Canadian Coast Guard  
Sydney MCTS Centre  
P.O. Box 8630  
SYDNEY, N.S. B1P 6K7  
Telephone: 902-564-7751 or 1-800-686-8676  
Facsimile: 902-564-2446  
Email: [notshipssyd@mar.dfo-mpo.gc.ca](mailto:notshipssyd@mar.dfo-mpo.gc.ca)

#### **Central & Arctic**

\* Fisheries and Oceans Canada,  
Canadian Coast Guard,  
Sarnia MCTS Centre  
# 215 - 105 Christina Street  
SARNIA ON N7T 7W1  
Telephone: 519 337-6360 or 1-800-265-0237  
Facsimile: 519 337-2498

Fisheries and Oceans Canada,  
Canadian Coast Guard,  
Inuvik MCTS Centre  
P.O. Box 2659  
INUVIK NT X0E 0T0  
Telephone: 867-777-2667  
Facsimile: 867-777-2851

\* Services provided in English and French

**NOTICE TO USERS  
MAILING LIST SUBSCRIPTION RENEWAL**

Dear Client:

We appreciate your continued interest in receiving the Monthly Edition of Notices to Mariners. As technology evolves, the Canadian Coast Guard is looking at means to reduce printing and distribution costs while continuing to provide quality service to the marine community.

Internet technology has become the primary information source worldwide for organizations and individuals to receive information and various publications. As the use of the internet grows in popularity, our organization feels it is the right time to limit our mail distribution and rely primarily on the internet for distribution of the Notices to Mariners. The information, supplied by the internet, has the advantage of being relayed to the mariner immediately and efficiently.

We also encourage you to visit the Notices to Mariners web site available at the following internet address [www.notmar.gc.ca](http://www.notmar.gc.ca) . This user-friendly site is available 24 hours a day, 7 days a week. You may also register online to receive an automatic e-mail notification when a new Notice to Mariners is issued against any nautical chart(s) that you frequently use. We encourage users to frequently visit the site to access all the latest Notices and related information.

The Coast Guard is committed to meeting the needs of our clients. Therefore, should you wish to remain on the hard-copy mailing list, we ask that you complete the following form. The renewal form is required no later than March 31<sup>st</sup>, 2008; at that time any renewals not received will be removed from the hard-copy mailing list.

We thank you very much for your cooperation.

Manager, Aids to navigation  
Navigation Systems

MONTHLY EDITION OF NOTICES TO MARINERS

MAILING LIST CHANGES

I WISH TO CONTINUE RECEIVING THE PAPER COPY OF THE NOTICE

Leader, Notices to Mariners
Navigation Aids
Navigation Systems
Canadian Coast Guard
200 Kent Street, Station 5N186
Ottawa, ON
K1A 0E6

Telephone (613) 993-6974
Facsimile (613) 998-8428
Internet www.notmar.gc.ca

Please indicate which edition you would like to receive.

EASTERN EDITION (Comprised of Arctic, Newfoundland, Maritimes, Gulf & River St. Lawrence and Central areas)

WESTERN EDITION (Comprised of Arctic and Pacific areas)

ADD AMEND REMOVE NO. OF COPIES

Form with sections for OLD ADDRESS and NEW ADDRESS, each containing fields for NAME, STREET, CITY, PROVINCE, APT., and POSTAL CODE.

ID number above address on label

or

Attach complete address label to this sheet

## INDEX

CANADIAN COAST GUARD - MARINE COMMUNICATION AND TRAFFIC SERVICES (MCTS) .....	2
CANADIAN HYDROGRAPHIC SERVICE - ANNOUNCEMENT REGARDING CANADIAN HYDROGRAPHIC SERVICE CHART PATCHES .....	1
CANADIAN HYDROGRAPHIC SERVICE - ARCTIC CHARTS .....	2
CANADIAN HYDROGRAPHIC SERVICE - CUMULATIVE CHART CORRECTIONS. ....	1
CANADIAN HYDROGRAPHIC SERVICE - CURRENT CHART EDITION DATES. ....	1
CANADIAN HYDROGRAPHIC SERVICE - PRINT ON DEMAND CHARTS - CARE AND USE.....	1
*1202 CANADIAN HYDROGRAPHIC SERVICE - ELECTRONIC NAVIGATION CHARTS. ....	2
*1201 CANADIAN HYDROGRAPHIC SERVICE - NAUTICAL CHARTS .....	2
*1204 CANADIAN HYDROGRAPHIC SERVICE - NON EQUIVALENT ELECTRONIC NAVIGATION CHARTS. ....	4
*1203 CANADIAN HYDROGRAPHIC SERVICE - RASTER NAVIGATION CHARTS .....	3
*1207(P) CANSO HARBOUR AND APPROACHES/ET LES APPROCHES - RANGE LIGHTS TO BE DISCONTINUED.....	4
*1211 CARIBOU HARBOUR - RANGE LIGHTS DISCONTINUED. ....	5
*1208 COUNTRY ISLAND TO BARREN ISLAND - BUOY DISCONTINUED. ....	5
*1210 HARBOURS ON THE NORTH SHORE - LIGHT DISCONTINUED.....	5
*1212 NEW BRUNSWICK - CHALEUR BAY - MISCOU ISLAND - FOG SIGNAL DISCONTINUED.....	5
*1213 NOVA SCOTIA, SOUTHWEST COAST - PLYMOUTH NARROWS - RADAR REFLECTORS DISCONTINUED.....	5
*1209 PICTOU HARBOUR - BUOYS DISCONTINUED.....	5
*1206 PRINCE EDWARD ISLAND - ST. PETERS HARBOUR - RANGE LIGHTS DISCONTINUED. ....	4
*1205 TRANSPORT CANADA - SHIP SAFETY BULLETIN.....	4
*1214(P) UPPER GAP TO/À TELEGRAPH NARROWS - BUOYS TO BE DISCONTINUED.....	5

---

**NUMERICAL INDEX OF CANADIAN CHARTS AFFECTED**

---

<b>Chart No.</b>	<b>Page</b>	<b>Chart No.</b>	<b>Page</b>	<b>Chart No.</b>	<b>Page</b>
1435	6	L/C4242	15	4839	21
1436	6-8	4244	15, 16	4844	22
1437	8	LC4320	16, 17	4849	22
1510	2, 8	4321	17	4864	22
2206	8 - 10	4381	17	4885	2, 22
L/C2300	10	4384	17	4905	22
2303	10	4386	17	5143	22
2304	10	4391	18	8007	22, 23
4003	10, 11	4394	18		
4012	11	4395	18		
4013	11, 12	4404	18		
4022	12	4405	19		
4023	12	4425	19		
4024	12	4437	19		
4114	12	4464	19		
4115	13	4473	20		
4116	2	4483	20		
L/C4118	13	4486	20		
4124	13	4585	20		
4202	13	4592	20		
4210	13, 14	4616	20		
4211	14	4622	21		
L/C4227	14	L/C4624	21		
L/C4230	14	4722	21		
4234	14	4725	21		
L/C 4240	14	4765	21		
4241	15	4821	21		

**SECTION 1 – Edition 12/2007  
SAFETY AND GENERAL INFORMATION**

**CANADIAN HYDROGRAPHIC SERVICE - ANNOUNCEMENT REGARDING CANADIAN HYDROGRAPHIC SERVICE CHART PATCHES.**

CHS is introducing a new initiative with a full colour Patch on the Web. A link in the Notices to Mariners web site will be provided so clients can access the colour Patch. The colour Patch will be published in HTML and PDF format. Providing the Patches in colour (accessible to all via remote access to the Web) is an enhanced form of alternative service delivery in line with CHS strategic objectives.

Colour Web Patches are free to the mariner, and given the quality of many printers, should reproduce well. They will be available in real time all around the world which is an improvement since clients had to wait for the paper copy to be mailed.

Previously, in the *Notices to Mariners* (NTM) booklet, Patches were produced in full colour or a minimum of black and magenta.

Due to current budgetary constraints, Patches will now only be produced in black and white for publication in the NTM booklet.

Our level of service will change with this initiative and CHS intends to analyze market reaction to this innovation.

CHS welcomes your feedback on this new service at [chsinfo@df-mpo.gc.ca](mailto:chsinfo@df-mpo.gc.ca)

**CANADIAN HYDROGRAPHIC SERVICE - CUMULATIVE CHART CORRECTIONS.**

The cumulative Notice to Mariners corrections for charts can now be accessed at [http://www.notmar.gc.ca/search/notmar\\_e.php](http://www.notmar.gc.ca/search/notmar_e.php)

**CANADIAN HYDROGRAPHIC SERVICE - CURRENT CHART EDITION DATES.**

**CHART EDITIONS**

The three terms described below are used to indicate the publication status of Canadian charts.

**NEW CHART - "NEWCHT"**

The first publication of a Canadian chart embracing an area not previously charted to the scale shown, or embracing an area different from any existing Canadian chart.

**NEW EDITION - "NEWEDT"**

A new issue of an existing chart containing amendments essential to navigation in addition to those issued in Notice to Mariners and making existing editions obsolete.

**REPRINTS**

A new issue of the current edition of a chart incorporating no amendments of navigational significance other than those previously promulgated in Notice to Mariners. It may also contain amendments from other sources provided they are not essential to navigation. Previous printings of the current edition remain in force.

The current chart edition dates can now be accessed at <http://www.chs-shc.gc.ca/pub/en/products/core.cfm>

**CANADIAN HYDROGRAPHIC SERVICE - PRINT ON DEMAND CHARTS - CARE AND USE.**

**Background**

By providing nautical charts to the public, the goal of the Canadian Hydrographic Service (CHS) is to provide services for safe navigation in a fiscally responsible manner. As a result, CHS continues to expand its portfolio of nautical paper charts that are printed using Print On Demand (POD) technology. These charts are easily recognized by their whiter paper and the coloured logo of the Canadian Hydrographic Service. This new technology enables CHS to print charts in a more efficient manner while enhancing chart content through being able to quickly add new and important information. POD technology provides customers with up-to-date charts without the historical hand-drawn corrections or glued-on patches. Additionally, this technology eliminates out-of-stock situations which arise with the traditional printing and warehousing methods. In the event of a national emergency, CHS can respond to the appropriate authorities with best available information very quickly.



**SECTION 1 – Edition 12/2007  
SAFETY AND GENERAL INFORMATION**

**Care of Your POD Chart**

CHS encourages its customers to handle the POD charts more carefully than the traditional lithographic charts. When plotting information on POD charts, use HB pencils and apply limited pressure. Testing has suggested that an Indian gum eraser is more effective than alternatives when used on the product. This eraser is also suitable for charts printed using lithographic processes.

**CANADIAN HYDROGRAPHIC SERVICE - ARCTIC CHARTS.**

Please be advised that effective February 2007 all Arctic notices will appear in both the Eastern and Western paper editions of Notices to Mariners.

Mariners may obtain all Arctic chart notices via the Canadian Coast Guard Notices to Mariners online service [www.notmar.gc.ca](http://www.notmar.gc.ca) or by contacting the Canadian Coast Guard, Notices to Mariners office at the following coordinates:

Leader, Notices to Mariners  
Aids to Navigation  
Navigation Systems  
Canadian Coast Guard  
200 Kent Street, Station 5N186  
Ottawa, ON  
K1A 0E6

Telephone (613) 993-6974  
Facsimile (613) 998-8428

**CANADIAN COAST GUARD - MARINE COMMUNICATION AND TRAFFIC SERVICES (MCTS).**

Marine Communications and Traffic Services will no longer provide the radiotelegram service subject to full international charges after December 31<sup>st</sup>, 2007. However, messages addressed to "Quarantine" and messages requesting a doctor to meet a ship on arrival will now be handled without charge. MCTS will continue to provide a Marine Telephone Call Service subject to full international charges in selected areas, based upon demand and the availability of alternate service delivery methods.

**\*1201 CANADIAN HYDROGRAPHIC SERVICE - NAUTICAL CHARTS.**

CHARTS	MAIN TITLE	SCALE	PUBLISHED	CAT#	PRICE
<b>New Edition</b>	All temporary and preliminary notices affecting the previous versions of the following chart(s) (is / are) now cancelled. For any outstanding notices please consult section 2 of this edition.				
4116	Approaches to/Approches à Saint John	1:60000	31-AUG-2007	1	\$20.00
4885	Port Harmon and Approaches/et les approches	1:40000	08-MAR-2002	1	\$20.00
<b>Reprint</b>					
1510	Lac des Deux Montagnes	1:30000	26-MAY-2006	3	\$18.00

**\*1202 CANADIAN HYDROGRAPHIC SERVICE - ELECTRONIC NAVIGATION CHARTS.**

RELEASED PRODUCTS	
S-57 ENC NUMBER	CHART TITLE
CA573099	Scudder
CA573315	Leamington Harbour
CA470375	Atli Inlet to/à Selwyn Inlet (South Portion, Part 1 of 2)
CA473233	Lake St. Francis
CA376014	Cape Sable Island to/aux Tusket Islands

**SECTION 1 – Edition 12/2007**  
**SAFETY AND GENERAL INFORMATION**

<b>RELEASED PRODUCTS</b>	
<b>S-57 ENC NUMBER</b>	<b>CHART TITLE</b>
CA176290	Labrador Sea, Strait of Belle Isle to/à Davis Strait
CA276477	Flemish Cap/Bonnet Flamand
CA476495	Continuation A - Sandwich Bay
CA479082	Continuation A

**\*1203 CANADIAN HYDROGRAPHIC SERVICE - RASTER NAVIGATION CHARTS.**

<b>CHARTS</b>	<b>MAIN TITLE</b>			
<b>New Chart</b>	All temporary and preliminary notices affecting the previous versions of the following chart(s) (is / are) now cancelled. For any outstanding notices please consult section 2 of this edition.			
R/M3944	Graham Reach to/à McKay Reach	21-SEP-2007		See Note 2
<b>New Edition</b>	All temporary and preliminary notices affecting the previous versions of the following chart(s) (is / are) now cancelled. For any outstanding notices please consult section 2 of this edition.			
R/M1312	Lac Saint-Pierre	08-JUN-2007		See Note 2
R/M1351A	Bassin de Chambly à/to Île Sainte-Thérèse	28-SEP-2007		See Note 2
R/M1351B	Île Sainte-Thérèse à/to Pointe à la Meule	28-SEP-2007		See Note 2
R/M1351C	Pointe à la Meule à/to Pointe Naylor	28-SEP-2007		See Note 2
R/M1351D	Pointe Naylor au Lac/to Lake Champlain	28-SEP-2007		See Note 2
R/M1437	Summerland Group to/à Grindstone Island	20-JUL-2007		See Note 2
R/M2028A	Lake Simcoe	15-JUN-2007		See Note 2
R/M2028B	Lake Couchiching Lake Simcoe to Couchiching Lock/Lake Simcoe à L'Écluse de Couchiching	15-JUN-2007		See Note 2
R/M2028C	Cook's Bay and/et Holland River	15-JUN-2007		See Note 2
R/M2122	Pointe aux Pins to/à Point Pelee	10-AUG-2007		See Note 2
R/M2305	Jackfish Bay	05-OCT-2007		See Note 2
R/M2306	Peninsula Harbour and/et Port Munro	24-AUG-2007		See Note 2
R/M4116	Approaches to Saint John / Approches à Saint John	31-AUG-2007		See Note 2
R/M6242A	Winnipeg to/à Selkirk	01-JUN-2007		See Note 2
R/M6242B	Selkirk to/à Lake Winnipeg	01-JUN-2007		See Note 2
<b>Charts Permanently Withdrawn</b>				
R/M3739	Swanson Bay to/à Work Island			

**SECTION 1 – Edition 12/2007  
SAFETY AND GENERAL INFORMATION**

**\*1204 CANADIAN HYDROGRAPHIC SERVICE - NON EQUIVALENT ELECTRONIC NAVIGATION CHARTS.**

**Note:** The following ENC products are not equivalent to the current editions of their corresponding paper charts and should not be used as a replacement.

<b>NON EQUIVALENT PRODUCTS</b>		
<b>S-57 ENC NUMBER</b>	<b>PAPER CHART NUMBER</b>	<b>CHART TITLE</b>
CA276286	4023	Northumberland Strait / Détroit de Northumberland
CA373067	2304	Oiseau Bay to/à Jackfish Bay
CA376045	4240	Liverpool Harbour to/à Lockeport Harbour
CA376047	4241	Lockeport to/à Cape Sable
CA376093	4367	Flint Island to/à Cape Smoky
CA376094	4020	Strait of Belle Isle/Détroit de Belle Isle
CA476179	4466	Hillsborough Bay
CA476202	4211	Cape Lahave to/à Liverpool Bay
CA476327	4596	Bay of Exploits Sheet/feuille II (Middle/centre)
CA476328	4597	Bay of Exploits Sheet/feuille III (South/sud)
CA576226	4587	Fishery Products International Wharves / Quais

**\*1205 TRANSPORT CANADA - SHIP SAFETY BULLETIN.**

A new Ship Safety Bulletin was published on November 21, 2007.

Title: Marine Medical Care and Marine First Aid (amendment 2007-11-01)

Number: 02/2007

Internet: <http://www.tc.gc.ca/marinesafety/Bulletins/2007/02-eng.htm>

A new Ship Safety Bulletin was published on December 4, 2007.

Title: Adequacy of Single Cross-bar Type Hatch Covers

Number: 12/2007

Internet: <http://www.tc.gc.ca/MarineSafety/bulletins/2007/12-eng.htm>

**\*1206 PRINCE EDWARD ISLAND - ST. PETERS HARBOUR - RANGE LIGHTS DISCONTINUED.**

Reference: Notice 207(P)/2007 is cancelled.

(G2007 145, 147)

**\*1207(P) CANSO HARBOUR AND APPROACHES/ET LES APPROCHES - RANGE LIGHTS TO BE DISCONTINUED.**

Reference chart: 4281

The Canadian Coast Guard intends to permanently discontinue the following aids to navigation:

Durell Island range lights LL 682.5; 682.4 (45° 21' 10.3900" N 61° 1' 16.5460" W approx.)

Comments on this action are solicited from mariners and other interested parties. Comments should be directed to Glen Graham, A/Superintendent, Aids to Navigation, Canadian Coast Guard, P.O. Box 1000, Dartmouth, NS, B2Y 3Z8, E-mail: [GrahamG@mar.dfo-mpo.gc.ca](mailto:GrahamG@mar.dfo-mpo.gc.ca), within three months from the date of this notice. Any objections raised must state the facts on which they are based and should include supporting information on safety, commerce and public benefit.

(G2007-179, 180)

**SECTION 1 – Edition 12/2007  
SAFETY AND GENERAL INFORMATION**

**\*1208 COUNTRY ISLAND TO BARREN ISLAND - BUOY DISCONTINUED.**

Reference: Notice 306(P)/2007 is cancelled.

(G2007 175)

**\*1209 PICTOU HARBOUR - BUOYS DISCONTINUED.**

Reference: Notice 505(P)/2007 is cancelled.

(G2007 169, 170)

**\*1210 HARBOURS ON THE NORTH SHORE - LIGHT DISCONTINUED.**

Reference: Notice 307(P)/2007 is cancelled.

(G2007 172)

**\*1211 CARIBOU HARBOUR - RANGE LIGHTS DISCONTINUED.**

Reference: Notice 610(P)/2007 is cancelled.

(G2007 149, 152)

**\*1212 NEW BRUNSWICK - CHALEUR BAY - MISCOU ISLAND - FOG SIGNAL DISCONTINUED.**

Reference: Notice 107(P)/2007 is cancelled.

(G2007 167)

**\*1213 NOVA SCOTIA, SOUTHWEST COAST - PLYMOUTH NARROWS - RADAR REFLECTORS DISCONTINUED.**

Reference: Notice 601(P)/2006 is cancelled.

(F2007 105, 106)

**\*1214(P) UPPER GAP TO/À TELEGRAPH NARROWS - BUOYS TO BE DISCONTINUED**

Reference chart: 2006

The Canadian Coast Guard intends to permanently discontinue the following aids to navigation:

Red Spar Buoy QD2 (44° 11' 35.7" N 77° 02' 40' W)

Green Spar Buoy QD3 (44° 11' 34.2" N 77° 02' 41.5' W)

Comments on this action are solicited from mariners and other interested parties. Comments should be directed to Mr. Ted Cater, Supervisor, Navigation System Program, Canadian Coast Guard, P.O. Box 1000, 401 King Street West, Prescott, ON, K0E 1T0; Phone: (613) 925-2865, Ext. 119; Fax: (613) 925-5540; EMAIL: [CATERT@DFO-MPO.GC.CA](mailto:CATERT@DFO-MPO.GC.CA) within three months from the date of this notice. Any objections raised must state the facts on which they are based and should include supporting information on safety, commerce and public benefit.

(B2007 058)

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

**1435 - Cardinal to/à Whaleback Shoal B-C - New Chart - 15-DEC-1995 - NAD 1983**

14-DEC-2007		LNMD. 10-AUG-2007
Delete	building and legend Phillips Cables (See Chart No.1, D5)	44°34'48.0"N 075°42'12.6"W  <i>DFO(6603032-03)</i>
Delete	chimney (See Chart No.1, E22)	44°34'49.1"N 075°42'10.0"W  <i>DFO(6603032-04)</i>
Delete	islet (See Chart No. 1, K10)	44°33'10.2"N 075°43'06.6"W  <i>DFO(6603032-05)</i>
Delete	islet (See Chart No. 1, K10)	44°34'12.4"N 075°41'48.9"W  <i>DFO(6603032-06)</i>

**1435 - Brockville Narrows - New Chart - 15-DEC-1995 - NAD 1983**

14-DEC-2007		LNMD. 10-AUG-2007
Delete	building and legend Phillips Cables (See Chart No.1, D5)	44°34'48.0"N 075°42'12.6"W  <i>DFO(6603032-03)</i>
Delete	chimney (See Chart No.1, E22)	44°34'49.1"N 075°42'10.1"W  <i>DFO(6603032-04)</i>
Replace	islet with rock which covers and uncovers with drying height of 1.2m (See Chart No. 1, K10 & K11)	44°33'10.2"N 075°43'06.6"W  <i>DFO(6603032-01)</i>
Replace	islet with rock which covers and uncovers with drying height of 0.8m (See Chart No. 1, K10 & K11)	44°34'12.4"N 075°41'48.9"W  <i>DFO(6603032-02)</i>

**1436 - Whaleback Shoal to/au Summerland Group - New Chart - 15-JAN-1993 - NAD 1983**

28-DEC-2007		LNMD. 22-SEP-2006
Delete	crib which does not cover	44°27'31.8"N 075°46'41.0"W  <i>DFO(6603033-02)</i>
Delete	crib which does not cover	44°27'32.5"N 075°46'40.0"W  <i>DFO(6603033-03)</i>
Delete	stump (See Chart No. 1, K43.2)	44°26'50.0"N 075°47'04.8"W  <i>DFO(6603033-06)</i>
Delete	crib which does not cover	44°26'50.8"N 075°47'27.0"W  <i>DFO(6603033-08)</i>
Delete	crib which does not cover	44°26'49.3"N 075°47'27.5"W  <i>DFO(6603033-09)</i>
Delete	crib which does not cover	44°26'47.7"N 075°47'27.7"W  <i>DFO(6603033-10)</i>

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

Delete	rock awash (See Chart No. 1, K12)	44°26'36.3"N 075°46'56.5"W  <i>DFO(6603033-13)</i>
Delete	crib which does not cover	44°25'28.2"N 075°48'04.5"W <i>DFO(6603033-16)</i>
Delete	flagstaff (See Chart No. 1, E27)	44°25'30.5"N 075°48'04.5"W  <i>DFO(6603033-18)</i>
Delete	submerged crib	44°24'49.0"N 075°48'04.0"W <i>DFO(6603033-24)</i>
Delete	crib which does not cover	44°24'39.8"N 075°47'30.1"W <i>DFO(6603033-27)</i>
Delete	flagstaff (See Chart No. 1, E27)	44°22'55.5"N 075°54'43.5"W  <i>DFO(6603033-29)</i>
Delete	tower (See Chart 1, E20)	44°22'08.8"N 075°56'11.0"W  <i>DFO(6603033-30)</i>
Delete	flagstaff (See Chart No. 1, E27)	44°21'46.2"N 075°55'56.4"W  <i>DFO(6603033-31)</i>
Replace	submerged crib with a crib which covers and uncovers	44°27'44.9"N 075°46'25.2"W <i>DFO(6603033-01)</i>
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°27'23.5"N 075°46'12.9"W  <i>DFO(6603033-04)</i>
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°25'59.3"N 075°47'05.0"W  <i>DFO(6603033-05)</i>
Replace	submerged crib with a crib which covers and uncovers	44°27'01.0"N 075°47'20.6"W <i>DFO(6603033-07)</i>
Replace	crib which does not cover with crib which covers and uncovers	44°26'44.8"N 075°47'35.0"W  <i>DFO(6603033-12)</i>
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°26'31.2"N 075°47'12.5"W  <i>DFO(6603033-14)</i>
Replace	rock which covers and uncovers with rock awash (See Chart No. 1, K 11 & K12)	44°25'59.0"N 075°47'48.0"W  <i>DFO(6603033-15)</i>
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°25'20.1"N 075°48'11.2"W  <i>DFO(6603033-17)</i>

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

Replace	rock which covers and uncovers with rock awash (See Chart No. 1, K 11 & K12)	44°25'29.5"N 075°48'38.2"W  DFO(6603033-19)
Replace	rock which covers and uncovers with rock awash (See Chart No. 1, K 11 & K12)	44°25'10.0"N 075°48'29.8"W  DFO(6603033-20)
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°24'46.0"N 075°48'53.5"W  DFO(6603033-21)
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°24'48.7"N 075°48'29.9"W  DFO(6603033-22)
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°24'52.9"N 075°48'30.0"W  DFO(6603033-23)
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°24'56.2"N 075°47'31.5"W  DFO(6603033-25)
Replace	islet with rock which covers and uncovers (See Chart No. 1, K10 & K11)	44°24'48.0"N 075°47'32.5"W  DFO(6603033-26)
Replace	overhead cable with submarine power cable (See Chart No. 1, D27 & L31.1)	between 44°23'55.8"N 075°49'51.9"W and 44°23'59.9"N 075°49'48.9"W DFO(6603033-28)
Add	depth of 2.3m (See Chart No. 1, I10)	44°26'49.6"N 075°47'27.3"W  DFO(6603033-11)

**1437 - Summerland Group to à Grindstone Island - New Edition - 20-JUL-2007 - NAD 1983**

28-DEC-2007

Add	submarine power cable (See Chart No. 1, L31.1)	between 44°23'55.8"N 075°49'51.9"W and 44°23'59.9"N 075°49'48.9"W DFO(6603033-32)
-----	---	---

**1510 - Lac Saint-Louis à/to Carillon - Compartment B-C - Sheet 1 - New Edition - 25-JUL-2003 - NAD 1983**

28-DEC-2007

Affix	patch	LNMD. 06-APR-2007 45°23'59.0"N 074°00'40.0"W DFO(6407571-01)
-------	-------	--

Download Patch - [http://www.chs-shc.gc.ca/patches/1510\\_PA\\_230718.pdf](http://www.chs-shc.gc.ca/patches/1510_PA_230718.pdf)

**2206 - 2206-2 - Sheet 1 - New Chart - 27-JUN-1997 - NAD 1983**

28-DEC-2007

Add	submarine power cable (See Chart No. 1, L31.1)	LNMD. 23-JUL-2004 joining 46°03'31.8"N 081°42'19.6"W 46°03'34.1"N 081°42'14.9"W and 46°03'36.9"N 081°42'13.9"W DFO(6603031-02)
-----	---	--

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**



**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

Add submarine power cable  
(See Chart No. 1, L31.1)

joining 46°03'36.9"N 081°42'13.9"W  
 46°03'36.8"N 081°42'03.8"W  
 46°03'39.0"N 081°41'40.0"W  
 46°03'36.9"N 081°41'26.5"W  
 46°03'27.6"N 081°40'59.0"W  
 46°03'23.0"N 081°40'32.0"W  
 46°03'17.6"N 081°40'18.8"W  
 46°03'17.3"N 081°40'03.0"W  
 46°03'17.8"N 081°39'54.8"W  
 46°03'15.4"N 081°39'47.6"W  
 and 46°03'13.5"N 081°39'44.2"W  
*DFO(6603031-03)*

Add submarine power cable  
(See Chart No. 1, L31.1)

joining 46°03'09.6"N 081°39'37.3"W  
 46°03'06.2"N 081°39'31.3"W  
 46°02'55.4"N 081°39'31.5"W  
 46°02'51.4"N 081°39'30.7"W  
 46°02'36.6"N 081°39'10.1"W  
 46°02'36.7"N 081°38'31.9"W  
 46°02'39.9"N 081°38'12.0"W  
 and 46°02'49.9"N 081°38'08.3"W  
*DFO(6603031-04)*

Add submarine power cable  
(See Chart No. 1, L31.1)

joining 46°02'49.9"N 081°38'08.3"W  
 46°02'38.0"N 081°37'37.1"W  
 46°02'34.6"N 081°37'14.8"W  
 46°02'34.7"N 081°36'22.0"W  
 46°02'31.2"N 081°35'54.0"W  
 and 46°02'24.5"N 081°35'43.3"W  
*DFO(6603031-05)*

**2206 - 2206-1 - Sheet 1 - New Chart - 27-JUN-1997 - NAD 1983**

28-DEC-2007

LNM/D. 23-JUL-2004

Add submarine power cable  
(See Chart No. 1, L31.1)

joining 46°04'02.6"N 081°45'54.7"W  
 46°04'01.3"N 081°45'54.3"W  
 46°03'56.4"N 081°45'37.5"W  
 46°03'53.8"N 081°45'17.6"W  
 46°03'46.3"N 081°45'00.2"W  
 46°03'47.8"N 081°44'58.1"W  
 46°03'45.0"N 081°44'42.9"W  
 46°03'46.4"N 081°44'26.0"W  
 46°03'37.9"N 081°44'02.2"W  
 46°03'38.2"N 081°43'53.0"W  
 and 46°03'42.2"N 081°43'50.8"W  
*DFO(6603031-01)*

Add submarine power cable  
(See Chart No. 1, L31.1)

joining 46°03'42.2"N 081°43'50.8"W  
 46°03'40.7"N 081°43'47.7"W  
 46°03'45.8"N 081°43'12.3"W  
 46°03'31.8"N 081°43'06.9"W  
 46°03'28.2"N 081°42'50.1"W  
 46°03'29.2"N 081°42'24.1"W  
 46°03'34.0"N 081°42'15.1"W  
 and 46°03'36.9"N 081°42'13.9"W  
*DFO(6603031-02)*

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

Add submarine power cable  
(See Chart No. 1, L31.1) joining 46°03'36.9"N 081°42'13.9"W  
46°03'36.8"N 081°42'04.0"W  
and 46°03'37.1"N 081°41'57.2"W  
DFO(6603031-03)

**2206 - Inset/Cartouche A - Sheet 1 - New Chart - 27-JUN-1997 - NAD 1983**

28-DEC-2007 LNM/D. 23-JUL-2004  
Add submarine power cable  
(See Chart No. 1, L31.1) between 46°03'44.0"N 081°43'11.6"W  
and 46°03'38.0"N 081°43'09.1"W  
DFO(6603031-02)

**2206 - 2206-4 - Sheet 2 - New Chart - 27-JUN-1997 - NAD 1983**

28-DEC-2007 LNM/D. 23-JUL-2004  
Add submarine power cable  
(See Chart No. 1, L31.1) joining 46°02'32.9"N 081°36'09.6"W  
46°02'31.2"N 081°35'54.0"W  
46°02'24.5"N 081°35'43.3"W  
46°02'24.1"N 081°35'35.1"W  
and 46°02'25.8"N 081°35'34.1"W  
DFO(6603031-05)

**L/C2300 - Lake Superior/Lac Supérieur - New Chart - 24-APR-1998 - NAD 1983**

28-DEC-2007 LNM/D. 28-APR-2006  
Amend legend Oc 15s 68m 10M to read FI(2) 15s 68m against light  
(See Chart No. 1, P16) 48°37'15.3"N 086°59'45.8"W  
(D2007054) LL(1111) DFO(6603067-01)

**2303 - Jackfish Bay to St. Ignace Island - New Edition - 18-MAY-1955 - US Standard Datum**

28-DEC-2007 LNM/D. 17-FEB-2006  
Amend legend Oc 15s 224 ft 10M to read FI(2) 15s 224 ft against light  
(See Chart No. 1, P16) 48°37'16.0"N 086°59'45.0"W  
(D2007054) LL(1111) DFO(6603067-01)

**2304 - Oiseau Bay to Jackfish Bay - New Edition - 20-FEB-2004 - NAD 1983**

28-DEC-2007  
Amend legend Oc 15s 224 ft 10M to read FI(2) 15s 224 ft against light  
(See Chart No. 1, P16) 48°37'19.0"N 086°59'44.8"W  
(D2007054) LL(1111) DFO(6603067-01)

**4003 - Cape Breton to Cape Cod - New Edition - 21-MAR-2003 - NAD 1983**

14-DEC-2007 LNM/D. 14-SEP-2007  
CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'18.0"N 063°14'18.0"W  
Caution note advertised on Chart 4320. See Notice 14-  
December-2007, DFO(6303647). Notice 6-July-2007(T),  
DFO(6303535) is now cancelled.  
DFO(6303535-01)

CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'46.3"N 063°14'19.0"W  
Caution note advertised on Chart 4320. See Notice 14-  
December-2007, DFO(6303647). Notice 6-July-2007(T),  
DFO(6303535) is now cancelled.  
DFO(6303535-02)

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

CANCELS      yellow ODAS/SADO lighted super-buoy FI (5) Y      44°17'50.6"N 063°15'41.6"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-03)*

CANCELS      yellow ODAS/SADO lighted super-buoy FI (5) Y      44°17'15.7"N 063°14'12.7"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-04)*

CANCELS      subsurface mooring      44°17'15.6"N 063°14'12.6"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-05)*

**4012 - Yarmouth toà Halifax - New Edition - 14-FEB-2003 - NAD 1983**

14-DEC-2007

LNM/D. 10-AUG-2007

CANCELS      yellow ODAS/SADO lighted super-buoy FI (5) Y      44°17'18.0"N 063°14'18.0"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-01)*

CANCELS      yellow ODAS/SADO lighted super-buoy FI (5) Y      44°17'46.3"N 063°14'19.0"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-02)*

CANCELS      yellow ODAS/SADO lighted super-buoy FI (5) Y      44°17'50.6"N 063°15'41.6"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-03)*

CANCELS      yellow ODAS/SADO lighted super-buoy FI (5) Y      44°17'15.7"N 063°14'12.7"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-04)*

CANCELS      subsurface mooring      44°17'15.6"N 063°14'12.6"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-05)*

**4013 - Halifax toà Sydney - New Edition - 06-SEP-2002 - NAD 1983**

14-DEC-2007

LNM/D. 10-AUG-2007

CANCELS      yellow ODAS/SADO lighted super-buoy FI (5) Y      44°17'18.0"N 063°14'18.0"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-01)*

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'46.3"N 063°14'19.0"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-02)*

CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'50.6"N 063°15'41.6"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-03)*

CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'15.7"N 063°14'12.7"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-04)*

CANCELS subsurface mooring 44°17'15.6"N 063°14'12.6"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-05)*

**4022 - Cabot Strait and approaches / Déroit de Cabot et les approches, Scatarie Island to/à Anticosti Island / Île D'Anticosti - New Edition - 17-JAN-2003 - NAD 1983**

14-DEC-2007 LNM/D. 17-AUG-2007  
Delete light FI 6s 30ft 13M 46°49'57.1"N 060°47'48.5"W  
(See Chart No 1 P16)

*(G2007155) LL(860.8) DFO(6303666-01)*

**4023 - Northumberland Strait / Déroit de Northumberland - New Edition - 27-DEC-2002 - NAD 1983**

28-DEC-2007 LNM/D. 10-AUG-2007  
Delete light FI 46°26'30.0"N 062°45'00.0"W  
(See Chart No 1 P16)

*(G2007172) LL(1044) DFO(6303735-01)*

**4024 - Baie des Chaleurs/Chaleur Bay aux/to Îles de la Madeleine - New Edition - 03-MAR-2000 - NAD 1983**

21-DEC-2007 LNM/D. 22-JUN-2007  
Delete legend Fog Sig against light 48°00'33.7"N 064°29'34.7"W  
(See Chart No 1R20 )

*(G2007167) LL(1264.7) DFO(6303708-01)*

**4114 - Campobello Island - New Edition - 29-SEP-2006 - NAD 1983**

28-DEC-2007 LNM/D. 23-MAR-2007  
Delete black, yellow and black East Cardinal spar buoy, marked SA 44°59'53.4"N 066°52'38.5"W  
(See Chart No 1 Q130.3)

*(F2007115) DFO(6303742-01)*

Add black, red and black isolated danger lighted spar buoy FI(2) 44°59'56.0"N 066°52'44.0"W  
5s, marked SA  
(See Chart No 1 Q130.4)

*(F2007116) LL(52.55) DFO(6303743-01)*

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

**4115 - Passamaquoddy Bay and/et St. Croix River - New Chart - 31-DEC-1999 - NAD 1983**

28-DEC-2007 LNM/D. 18-MAY-2007  
Delete black, yellow and black East Cardinal spar buoy, marked SA 44°59'53.4"N 066°52'38.5"W  
(See Chart No 1 Q130.3)  
(F2007115) DFO(6303742-01)

Add black, red and black isolated danger lighted spar buoy FI(2) 44°59'56.0"N 066°52'44.0"W  
5s, marked SA  
(See Chart No 1 Q130.4)  
(F2007116) LL(52.55) DFO(6303743-01)

**L/C4118 - St.Marys Bay - New Edition - 13-NOV-1998 - NAD 1983**

28-DEC-2007 LNM/D. 10-AUG-2007  
Amend FR to read FG against light 44°26'37.0"N 066°07'45.0"W  
(See Chart No 1, P16.)  
(F2007110) LL(230) DFO(6303720-01)

**L/C4118 - Continuation A - New Edition - 13-NOV-1998 - NAD 1983**

28-DEC-2007 LNM/D. 10-AUG-2007  
Amend FR to read FG against light 44°26'37.0"N 066°07'45.0"W  
(See Chart No 1, P16.)  
(F2007110) LL(230) DFO(6303720-01)

**4124 - Letete Passage, Letang Harbour and/et Blacks Harbour - New Edition - 07-APR-2000 - NAD 1983**

28-DEC-2007 LNM/D. 04-MAY-2007  
Delete black, yellow and black East Cardinal spar buoy, marked SA 44°59'53.4"N 066°52'38.5"W  
(See Chart No 1 Q130.3)  
(F2007115) DFO(6303742-01)

Add black, red and black isolated danger lighted spar buoy FI(2) 44°59'56.0"N 066°52'44.0"W  
5s, marked SA  
(See Chart No 1 Q130.4)  
(F2007116) LL(52.55) DFO(6303743-01)

**4202 - Halifax Harbour Point Pleasant to/à Bedford Basin - New Edition - 31-DEC-1999 - NAD 1983**

28-DEC-2007 LNM/D. 23-NOV-2007  
Add entry prohibited area with the legend 'Fenced/Ciôturé'.  
(See Chart No. 1, N31)  
joining 44°39'14.3"N 063°34'34.6"W  
44°39'17.3"N 063°34'27.7"W  
44°39'20.6"N 063°34'28.7"W  
44°39'24.9"N 063°34'33.7"W  
44°39'35.2"N 063°34'50.1"W  
44°39'37.3"N 063°34'54.9"W  
44°39'39.5"N 063°35'00.7"W  
44°39'42.0"N 063°35'08.9"W  
and 44°39'40.9"N 063°35'10.6"W  
DFO(6303754-01)

**4210 - Cape Sable to/à Pubnico Harbour - New Chart - 05-APR-1991 - NAD 1983**

28-DEC-2007 LNM/D. 21-SEP-2007  
CANCELS yellow, black and yellow West cardinal lighted spar buoy Q(9) 43°24'59.3"N 065°39'18.9"W  
15s, marked NAC with red starboard hand lighted spar buoy  
FIR, marked NA6  
Buoy permanently established. Notice 11-August-2006(T),  
DFO (6303060-01) is now cancelled. See reference  
DFO(6303674-01) appearing in this edition.  
(F2006015) LL(324) DFO(6303060-01)

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

Replace yellow, black and yellow West cardinal lighted spar buoy Q(9) 43°24'59.3"N 065°39'18.9"W  
15s, marked NAC with yellow, black and yellow West cardinal  
lighted pillar buoy Q(9) 15s, marked NAC  
  
(F2007083) LL(324) DFO(6303674-01)

**4211 - Cape Lahave to/à Liverpool Bay - New Edition - 20-JUN-2003 - NAD 1983**

21-DEC-2007 LNM/D. 21-SEP-2007  
Add light FIG against green port hand spar buoy, marked TU53 44°09'36.8"N 064°28'40.3"W  
(See Chart No 1, Qg)  
  
(F2007094) LL(417.81) DFO(6303692-01)

Add red starboard hand lighted spar buoy FIR, marked TU54 44°09'37.7"N 064°28'48.2"W  
(See Chart No 1, Qf)  
  
(F2007097) LL(419) DFO(6303705-01)

**L/C4227 - Country Harbour to/au Ship Harbour - New Chart - 24-MAY-1991 - NAD 1983**

28-DEC-2007 LNM/D. 06-JUL-2007  
Delete green port hand spar buoy, marked TU1 45°02'36.0"N 061°37'42.0"W  
(See Chart No 1 Qg)  
  
(G2007175) LL(5634.41) DFO(6303727-01)

**L/C4230 - Little Hope Island to/à Cape St. Marys - New Chart - 15-JUN-1990 - NAD 1983**

21-DEC-2007 LNM/D. 04-MAY-2007  
Replace green port hand spar buoy, marked KA51 with green port 43°43'12.0"N 064°58'00.0"W  
hand lighted pillar buoy FIG, marked KA51  
  
(F2007087) LL(386.01) DFO(6303678-01)

Add light VQ(6)+LFI 10s against yellow and black South cardinal 43°39'00.0"N 065°14'07.8"W  
spar buoy, marked KSA  
(See Chart No 1, Q130.3.)  
  
(F2007088) LL(357.8) DFO(6303679-01)

28-DEC-2007 LNM/D. 21-DEC-2007  
CANCELS yellow, black and yellow West cardinal lighted spar buoy Q(9) 43°24'59.3"N 065°39'18.9"W  
15s, marked NAC with red starboard hand lighted spar buoy  
FIR, marked NA6  
  
Buoy permanently established. Notice 11-August-2006(T),  
DFO (6303060-01) is now cancelled. See reference  
DFO(6303674-01) appearing in this edition.  
  
(F2006015) LL(324) DFO(6303060-01)

Replace yellow, black and yellow West cardinal lighted spar buoy Q(9) 43°24'59.3"N 065°39'18.9"W  
15s, marked NAC with yellow, black and yellow West cardinal  
lighted pillar buoy Q(9) 15s, marked NAC  
  
(F2007083) LL(324) DFO(6303674-01)

**4234 - Country Island to/à Barren Island - New Chart - 10-APR-1987 - NAD 1983**

28-DEC-2007 LNM/D. 10-AUG-2007  
Delete green port hand spar buoy, marked TU1 45°02'36.0"N 061°37'42.0"W  
(See Chart No 1 Qg)  
  
(G2007175) LL(5634.41) DFO(6303727-01)

**L/C4240 - Liverpool Harbour to/à Lockeport Harbour - New Chart - 06-OCT-1989 - NAD 1983**

21-DEC-2007 LNM/D. 23-MAR-2007  
Replace green port hand spar buoy, marked KA51 with green port 43°43'12.0"N 064°58'00.0"W  
hand lighted pillar buoy FIG, marked KA51  
  
(F2007087) LL(386.01) DFO(6303678-01)

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

**4241 - Lockport to/à Cape Sable - New Edition - 08-NOV-2002 - NAD 1983**

21-DEC-2007 LNM/D. 02-NOV-2007  
 Add light VQ(6)+LFI 10s against yellow and black South cardinal  
 spar buoy, marked KSA 43°39'00.0"N 065°14'07.8"W  
 (See Chart No 1, Q130.3.)  
 (F2007088) LL(357.8) DFO(6303679-01)

28-DEC-2007 LNM/D. 21-DEC-2007  
 CANCELS yellow, black and yellow West cardinal lighted spar buoy Q(9)  
 15s, marked NAC with red starboard hand lighted spar buoy  
 FIR, marked NA6 43°24'59.3"N 065°39'18.9"W  
 Buoy permanently established. Notice 11-August-2006(T),  
 DFO (6303060-01) is now cancelled. See reference  
 DFO(6303674-01) appearing in this edition.  
 (F2006015) LL(324) DFO(6303060-01)

Replace yellow, black and yellow West cardinal lighted spar buoy Q(9)  
 15s, marked NAC with yellow, black and yellow West cardinal  
 lighted pillar buoy Q(9) 15s, marked NAC 43°24'59.3"N 065°39'18.9"W  
 (F2007083) LL(324) DFO(6303674-01)

**L/C4242 - Cape Sable Island to/aux Tusket Islands - New Edition - 28-AUG-1992 - NAD 1983**

28-DEC-2007 LNM/D. 21-SEP-2007  
 CANCELS yellow, black and yellow West cardinal lighted spar buoy Q(9)  
 15s, marked NAC with red starboard hand lighted spar buoy  
 FIR, marked NA6 43°24'59.3"N 065°39'18.9"W  
 Buoy permanently established. Notice 11-August-2006(T),  
 DFO (6303060-01) is now cancelled. See reference  
 DFO(6303674-01) appearing in this edition.  
 (F2006015) LL(324) DFO(6303060-01)

Replace yellow, black and yellow West cardinal lighted spar buoy Q(9)  
 15s, marked NAC with yellow, black and yellow West cardinal  
 lighted pillar buoy Q(9) 15s, marked NAC 43°24'59.3"N 065°39'18.9"W  
 (See Chart No 1, Q130.3.)  
 (F2007083) LL(324) DFO(6303674-01)

**4244 - Wedgeport and Vicinity/et les Abords - New Edition - 26-DEC-2003 - NAD 1983**

14-DEC-2007 LNM/D. 09-FEB-2007  
 Delete green port hand can buoy, marked A13 43°42'39.3"N 065°50'23.9"W  
 (See Chart No 1 Qg)  
 (F2007084) DFO(6303675-01)

Add black, red and black isolated danger spar buoy, marked NAD 43°42'41.8"N 065°50'32.6"W  
 (See Chart No 1 Q130.4)  
 (F2007085) DFO(6303676-01)

Add light FIR against red starboard hand spar buoy, marked A6 43°40'33.3"N 065°51'25.3"W  
 (See Chart No 1 Qf)  
 (F2007086) LL(297.6) DFO(6303677-01)

21-DEC-2007 LNM/D. 14-DEC-2007  
 Delete radar reflector 43°47'11.9"N 065°59'40.8"W  
 (See Chart No 1 S4)  
 (F2007105) DFO(6303710-01)

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

Delete	radar reflector (See Chart No 1 S4)	43°46'55.1"N 065°59'32.6"W  (F2007106) DFO(6303711-01)
(T)Delete	light FIR (See Chart No 1 P16)  Deadmans Ledge light replaced with buoy.	43°44'02.0"N 065°56'37.8"W  LL(294.5) DFO(6303672-01)
(T)Add	red starboard hand lighted spar buoy FIR, marked TE2/2 (See Chart No 1 Qf)  Buoy replaces Deadmans Ledge light.	43°44'04.6"N 065°56'41.6"W  (F2007096T) LL(294.551) DFO(6303694-01)

**L/C4320 - Egg Island to à West ironbound Island - New Edition - 26-SEP-1997 - NAD 1983**

14-DEC-2007		LNMD. 06-APR-2007
CANCELS	yellow ODAS/SADO lighted super-buoy FI (5) Y Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.	44°17'18.0"N 063°14'18.0"W  DFO(6303535-01)
CANCELS	yellow ODAS/SADO lighted super-buoy FI (5) Y Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.	44°17'46.3"N 063°14'19.0"W  DFO(6303535-02)
CANCELS	yellow ODAS/SADO lighted super-buoy FI (5) Y Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.	44°17'50.6"N 063°15'41.6"W  DFO(6303535-03)
CANCELS	yellow ODAS/SADO lighted super-buoy FI (5) Y Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.	44°17'15.7"N 063°14'12.7"W  DFO(6303535-04)
CANCELS	subsurface mooring Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.	44°17'15.6"N 063°14'12.6"W  DFO(6303535-05)
Add	See CAUTION NO. 2/Voir ATTENTION n°2	44°17'30.0"N 063°14'00.0"W DFO(6303647-01)



**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

Add	note: CAUTION NO. 2 Mariners are advised to exercise caution when navigating in the general area of 44-17-30N, 63-14-00W, numerous subsurface moorings and scientific buoys may be encountered.  ATTENTION n°2 Les navigateurs sont priés de redoubler de prudence en naviguant dans les environs de 44-17-30N et 63-14-00W, car il peut y avoir de nombreux ancrages et bouées scientifiques sous la surface de l'eau.  (See Chart No 1 Section A 14.)	to the upper east margin of chart
		<i>DFO(6303647-02)</i>
 <b>4321 - Cape Canso to Liscomb Island - New Edition - 08-OCT-2004 - NAD 1983</b>		
28-DEC-2007		LNM/D. 06-JUL-2007
Delete	green port hand spar buoy, marked TU1 (See Chart No 1 Qg)	45°02'36.0"N 061°37'42.0"W  <i>(G2007175) LL(5634.41) DFO(6303727-01)</i>
 <b>4381 - Mahone Bay - New Edition - 31-JAN-2003 - NAD 1983</b>		
28-DEC-2007		LNM/D. 08-DEC-2006
Reposition	yellow cautionary spar buoy, marked MEA (See Chart No 1 Qm)	from 44°24'47.5"N 064°17'57.7"W to 44°24'47.2"N 064°18'02.4"W <i>(F2007090) DFO(6303685-01)</i>
Reposition	red starboard hand spar buoy, marked ME64 (See Chart No 1 Qf)	from 44°24'32.4"N 064°18'55.2"W to 44°24'30.9"N 064°18'56.1"W <i>(F2007091) DFO(6303686-01)</i>
Reposition	red starboard hand spar buoy, marked ME66 (See Chart No 1 Qf)	from 44°24'30.4"N 064°19'00.7"W to 44°24'30.0"N 064°19'03.9"W <i>(F2007092) DFO(6303687-01)</i>
Amend	FR to read FIR against light (See Chart No 1 P16)	44°28'23.5"N 064°05'32.2"W  <i>(F2007095) LL(467) DFO(6303693-01)</i>
 <b>4384 - Pearl Island to/à Cape La Have - New Edition - 10-JAN-2003 - NAD 1983</b>		
21-DEC-2007		LNM/D. 21-SEP-2007
Add	light FIG against green port hand spar buoy, marked TU53 (See Chart No 1, Qg)	44°09'36.8"N 064°28'40.3"W  <i>(F2007094) LL(417.81) DFO(6303692-01)</i>
Add	red starboard hand lighted spar buoy FIR, marked TU54 (See Chart No 1, Qf)	44°09'37.7"N 064°28'48.2"W  <i>(F2007097) LL(419) DFO(6303705-01)</i>
 <b>4386 - St.Margaret's Bay - New Edition - 16-JUL-2004 - NAD 1983</b>		
28-DEC-2007		LNM/D. 01-DEC-2006
Amend	FR to read FIR against light (See Chart No 1 P16)	44°28'24.0"N 064°05'33.0"W  <i>(F2007095) LL(467) DFO(6303693-01)</i>

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

**4391 - Lahave River Conquerall Bank to/à Bridgewater - New Edition - 20-DEC-2002 - NAD 1983**

21-DEC-2007

Reposition red starboard hand spar buoy, marked T90  
(See Chart No 1 Qf) from 44°22'10.8"N 064°29'51.9"W  
to 44°22'10.1"N 064°29'51.8"W  
(F2007100) DFO(6303714-01)

Reposition red starboard hand spar buoy, marked T92  
(See Chart No 1 Qf) from 44°22'10.8"N 064°30'02.6"W  
to 44°22'10.3"N 064°30'02.5"W  
(F2007103) DFO(6303715-01)

Add green port hand spar buoy, marked T77  
(See Chart No 1 Qg) 47°22'01.4"N 064°27'53.3"W  
(F2007104) LL(5427.085) DFO(6303680-01)

**4394 - Lahave River West Ironbound Island to/à Riverport - New Edition - 26-JUL-2002 - NAD 1983**

14-DEC-2007

LNM/D. 05-MAR-2004

Delete red starboard hand lighted pillar buoy FIR, marked T56  
(See Chart No 1 Qf) 44°15'45.3"N 064°21'34.8"W  
(F2007101) LL(427) DFO(6303716-01)

Delete green port hand spar buoy, marked TD51  
(See Chart No 1 Qg) 44°15'43.3"N 064°20'40.5"W  
(F2007102) DFO(6303717-01)

Add red starboard hand lighted pillar buoy QR, marked T56  
(See Chart No 1 Qf) 44°15'50.6"N 064°21'32.8"W  
(F2007101) LL(427) DFO(6303716-02)

Add green port hand can buoy, marked TD51  
(See Chart No 1 Qg) 44°15'57.0"N 064°20'46.0"W  
(F2007102) LL(5426.01) DFO(6303717-02)

Add red starboard hand lighted spar buoy FIR, marked T54/2  
(See Chart No 1 Qf) 44°15'41.8"N 064°21'26.3"W  
(F2007109) LL(426.5) DFO(6303739-01)

**4395 - Lahave River Riverport to/à Conquerall Bank - New Edition - 04-JUL-2003 - NAD 1983**

28-DEC-2007

Add green port hand spar buoy, marked T71  
(See Chart No 1 Qg) 44°20'01.7"N 064°25'58.7"W  
(F2007107) LL(5427.065) DFO(6303718-01)

Add red starboard hand spar buoy, marked T74  
(See Chart No 1 Qf) 44°21'02.6"N 064°26'20.3"W  
(F2007108) LL(5427.0651) DFO(6303719-01)

**4404 - Cape George to/à Pictou - New Edition - 12-MAY-2000 - NAD 1983**

14-DEC-2007

LNM/D. 20-JUL-2007

Delete front range/leading light FY  
(See Chart No 1Pe) 45°56'54.5"N 062°45'04.9"W  
(G2007152) LL(973) DFO(6303665-01)

Delete rear range/leading light FY with leading line and bearing  
legend 002½° 182½°  
(See Chart No 1Pe) 45°56'59.7"N 062°45'04.5"W  
(G2007149) LL(974) DFO(6303665-02)

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

**4405 - Pictou Island to/aux Tryon Shoals - New Edition - 21-FEB-2003 - NAD 1983**

14-DEC-2007 LNM/D. 17-FEB-2006  
Delete front range/leading light QG 45°56'54.5"N 062°45'04.9"W  
(See Chart No 1Pe )  
*(G2007152) LL(973) DFO(6303665-01)*

Delete rear range/leading light Iso G with leading line and bearing 45°56'59.7"N 062°45'04.5"W  
legend 002½° 182½°  
(See Chart No 1Pe )  
*(G2007149) LL(974) DFO(6303665-02)*

**4425 - St.Peters Bay - New Edition - 01-NOV-2002 - NAD 1983**

14-DEC-2007 LNM/D. 29-JUN-2007  
Delete front range/leading light QR 20ft 46°26'29.4"N 062°44'25.0"W  
(See Chart No 1Pe )  
*(G2007145) LL(1045) DFO(6303661-01)*

Delete rear range/leading light Iso R 41ft with leading line and legend 46°26'15.8"N 062°44'13.5"W  
See CAUTION/Voir ATTENTION  
(See Chart No 1Pe )  
*(G2007147) LL(1046) DFO(6303661-02)*

28-DEC-2007 LNM/D. 14-DEC-2007  
Delete light Fl 46°26'30.9"N 062°44'51.3"W  
(See Chart No 1 P16)  
*(G2007172) LL(1044) DFO(6303735-01)*

**4425 - Entrance to/entrée à St.Peters Bay - New Edition - 01-NOV-2002 - NAD 1983**

14-DEC-2007 LNM/D. 29-JUN-2007  
Delete front range/leading light QR 20ft 46°26'29.4"N 062°44'25.0"W  
(See Chart No 1Pe )  
*(G2007145) LL(1045) DFO(6303661-01)*

Delete rear range/leading light Iso R 41ft with leading line and legend 46°26'15.8"N 062°44'13.5"W  
See CAUTION/Voir ATTENTION  
(See Chart No 1Pe )  
*(G2007147) LL(1046) DFO(6303661-02)*

**4437 - Pictou Harbour - New Edition - 14-MAR-2003 - NAD 1983**

07-DEC-2007 LNM/D. 22-DEC-2006  
Delete green port hand lighted spar buoy FIG, marked SJ1 45°41'47.5"N 062°37'40.0"W  
(See Chart No 1 Qg)  
*(G2007169) LL(900.7) DFO(6303732-01)*

Delete red starboard hand spar buoy, marked SJ14 45°40'33.3"N 062°41'53.7"W  
(See Chart No 1 Qf)  
*(G2007170) DFO(6303733-01)*

**4437 - Pictou - New Edition - 14-MAR-2003 - NAD 1983**

07-DEC-2007 LNM/D. 22-DEC-2006  
Delete red starboard hand spar buoy, marked SJ14 45°40'33.3"N 062°41'53.7"W  
(See Chart No 1 Qf)  
*(G2007170) DFO(6303733-01)*

**4464 - Chéticamp to/à Cape St. Lawrence - New Edition - 10-JAN-2003 - NAD 1983**

14-DEC-2007 LNM/D. 06-JAN-2006  
Delete light Fl 6s 34ft 13M 46°49'57.1"N 060°47'48.5"W  
(See Chart No 1 P16)  
*(G2007155) LL(860.8) DFO(6303666-01)*

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

**4473 - Île de la Grande Passe aux/to Îles Bun - New Edition - 28-OCT-2005 - NAD 1983**

21-DEC-2007 LNM/D. 31-AUG-2007  
Delete front range/leading light Iso R 2s 17m 12M 51°09'09.8"N 058°32'57.3"W  
(See Chart No. 1, P20.2)  
LL(1542.45) DFO(6407551-01)

Delete rear range/leading light Iso R 2s 20m 12M with leading line 265½°, 99m from the front range/leading  
and bearing legend 265 ½° light  
(See Chart No. 1, P20.2)  
LL(1542.46) DFO(6407551-02)

Add front range/leading light Iso R 2s 17m 12M 51°09'09.8"N 058°32'57.3"W  
(See Chart No. 1, P20.2)  
LL(1542.45) DFO(6407551-03)

Add rear range/leading light Iso R 2s 20m 12M with leading line 269½°, 99m from the front range/leading  
bearing 269½° and bearing legend 269½° light  
(See Chart No. 1, P20.2)  
LL(1542.46) DFO(6407551-04)

**4483 - Wood Islands ferry terminal / terminal du traversier - New Edition - 10-JAN-2003 - NAD 1983**

14-DEC-2007 LNM/D. 20-JUL-2007  
Delete front range/leading light FY 7m 45°56'54.5"N 062°45'04.9"W  
(See Chart No 1Pe )  
(G2007152) LL(973) DFO(6303665-01)

Delete rear range/leading light FY 11m with leading line and bearing 45°56'59.7"N 062°45'04.5"W  
legend 002½° 182½°  
(See Chart No 1Pe )  
(G2007149) LL(974) DFO(6303665-02)

**4486 - Baie des Chaleurs/Chaleur Bay - New Edition - 19-FEB-1999 - NAD 1983**

21-DEC-2007 LNM/D. 21-SEP-2007  
Delete legend Fog Sig 60 s against light 48°00'33.7"N 064°29'34.7"W  
(See Chart No 1R20 )  
(G2007167) LL(1264.7) DFO(6303708-01)

**4585 - Green Head to/à Little Bay Island - New Edition - 30-MAY-2003 - NAD 1983**

14-DEC-2007  
Add light FIR 49°41'14.0"N 056°00'15.0"W  
(See Chart No 1 Section P 16.)  
(N2007044) LL(327.8) DFO(6303635-01)

**4592 - Little Bay Island to/à League Rock - New Edition - 10-OCT-2003 - NAD 1983**

28-DEC-2007 LNM/D. 01-DEC-2006  
Add light FIR 49°34'03.0"N 055°44'10.8"W  
(See Chart No 1 P16)  
(N2007056) LL(332.9) DFO(6303712-01)

**4616 - Burin Harbours and Approches / et les approches - New Edition - 06-JUN-2003 - NAD 1983**

14-DEC-2007 LNM/D. 10-FEB-2006  
Amend FIG to read 2Lts FIR & FIG against light 47°01'51.7"N 055°10'21.9"W  
(See Chart No 1 P16)  
(N2007054) LL(68.53) DFO(6303644-01)

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

**4622 - Cape St. Mary's to/à Argentinia Harbour and/et Jude Island - New Edition - 03-OCT-2003 - NAD 1983**

21-DEC-2007 LNM/D. 05-MAY-2006  
 Add private yellow lighted pillar Fl (5) Y 46°58'54.0"N 054°41'06.0"W  
 (See Chart No 1 Section Q 23.)  
 DFO(6303671-01)

**L/C4624 - Long Island to/à St. Lawrence Harbours - New Edition - 07-JAN-2000 - NAD 1983**

21-DEC-2007 LNM/D. 11-APR-2003  
 Add private yellow lighted pillar Fl (5) Y 46°58'54.0"N 054°41'06.0"W  
 (See Chart No 1 Section Q 23.)  
 DFO(6303671-01)

**4722 - Terrington Basin - New Edition - 22-NOV-2002 - NAD 1983**

28-DEC-2007 LNM/D. 16-MAR-2007  
 Delete depth of 36 feet 53°21'02.8"N 060°20'54.5"W  
 (See Chart No 1 I10)  
 DFO(6303749-01)

Add depth of 28 feet 53°21'02.9"N 060°20'54.6"W  
 (See Chart No 1 I10)  
 DFO(6303749-02)

**4725 - Carrington Island to/à Etageulet Bay - New Edition - 23-AUG-2002 - NAD 1983**

14-DEC-2007 LNM/D. 13-MAY-2005  
 Add ferry route joining 53°51'33.2"N 059°07'56.0"W  
 53°55'12.0"N 058°58'36.0"W  
 53°57'15.0"N 058°55'00.0"W  
 53°58'21.0"N 058°44'12.0"W  
 and 54°02'03.5"N 058°34'56.0"W  
 DFO(6303296-01)

**4765 - Saglek Bay to/à Hebron Fiord - New Edition - 31-MAY-2002 - Unknown**

28-DEC-2007  
 Add daybeacon, Bn Y 58°29'45.0"N 062°44'54.0"W  
 (See Chart No 1 Q81)  
 DFO(6303753-01)

**4821 - White Bay and/et Notre Dame Bay - New Chart - 23-APR-2004 - NAD 1983**

14-DEC-2007 LNM/D. 28-SEP-2007  
 Add light FIR 49°41'17.0"N 056°00'15.0"W  
 (See Chart No 1 Section P 16.)  
 (N2007044) LL(327.8) DFO(6303635-01)

**4839 - Head of/Fond de Placentia Bay - New Edition - 01-AUG-2003 - NAD 1983**

21-DEC-2007 LNM/D. 23-MAR-2007  
 Add private yellow lighted pillar Fl (5) Y 47°47'22.0"N 054°02'42.0"W  
 (See Chart No 1 Section Q 23.)  
 DFO(6303682-01)

**4839 - Come by Chance and/et Arnold's Cove - New Edition - 01-AUG-2003 - NAD 1983**

21-DEC-2007 LNM/D. 23-MAR-2007  
 Add private yellow lighted pillar Fl (5) Y 47°47'22.0"N 054°02'42.0"W  
 (See Chart No 1 Section Q 23.)  
 DFO(6303682-01)

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

**4844 - Renewes Harbour - New Edition - 08-MAR-2002 - NAD 1983**

14-DEC-2007 LNM/D. 19-OCT-2007  
Delete coastline joining 46°55'44.7"N 052°56'52.0"W  
(See Chart No 1 Section C 1.) 46°55'44.4"N 052°56'53.3"W  
and 46°55'44.3"N 052°56'51.6"W  
DFO(6303606-03)

Add light FIR 46°55'43.6"N 052°56'51.1"W  
(See Chart No 1 Section P 16.) (N2007026) LL(515.57) DFO(6303606-01)

Add breakwater with legend Bkw between 46°55'44.7"N 052°56'52.0"W  
(See Chart 1 F4.1) and 46°55'43.3"N 052°56'50.9"W  
DFO(6303606-02)

**4849 - The Admiral's Marina - New Chart - 30-DEC-1988 - NAD 1983**

28-DEC-2007 LNM/D. 19-OCT-2007  
Affix patch 47°40'24.0"N 053°14'27.0"W  
(N2006117) LL(482.789) DFO(6303760-01)

Download Patch - [http://www.chs-shc.gc.ca/patches/4849\\_PA\\_225573.pdf](http://www.chs-shc.gc.ca/patches/4849_PA_225573.pdf)

**4864 - Black Island to/à Little Denier Island - New Chart - 25-AUG-2006 - NAD 1983**

28-DEC-2007  
Amend FR to read FIR against light 49°20'23.8"N 055°23'51.4"W  
(See Chart No 1 P16) (N2007057) LL(345) DFO(6303744-01)

**4885 - Port Harmon - New Edition - 08-MAR-2002 - NAD 1983**

28-DEC-2007 LNM/D. 22-JUN-2007  
Affix patch 48°31'40.0"N 058°31'39.0"W  
DFO(6303759-01)

Download Patch - [http://www.chs-shc.gc.ca/patches/4885\\_PA\\_225073.pdf](http://www.chs-shc.gc.ca/patches/4885_PA_225073.pdf)

**4905 - Cape Tormentine à/to West Point - New Edition - 29-DEC-2000 - NAD 1983**

14-DEC-2007 LNM/D. 28-SEP-2007  
Add red starboard hand lighted pillar buoy FIR, marked DJ20 46°33'16.8"N 064°05'10.2"W  
(G2007132) LL(1027.43) DFO(6303648-01)

**5143 - Lake Melville - New Edition - 07-MAR-2003 - NAD 1983**

14-DEC-2007 LNM/D. 25-NOV-2005  
Add ferry route joining 53°29'01.2"N 059°57'52.0"W  
53°30'12.0"N 059°58'31.0"W  
53°32'30.0"N 059°56'42.0"W  
53°55'12.0"N 058°58'36.0"W  
53°57'15.0"N 058°55'00.0"W  
and 53°57'55.1"N 058°48'26.1"W  
DFO(6303353-01)

**8007 - Halifax to/à Sable Island/Île de Sable, Including/y compris Emerald Bank/Banc d'Émeraude and/et Sable Island Bank/Banc de l'Île de Sable - New Edition - 30-AUG-2002 - NAD 1983**

14-DEC-2007 LNM/D. 02-JUN-2006  
CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'18.0"N 063°14'18.0"W

**SECTION 2 – Edition 12/2007  
CHART CORRECTIONS**

Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-01)*

CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'46.3"N 063°14'19.0"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-02)*

CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'50.6"N 063°15'41.6"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-03)*

CANCELS yellow ODAS/SADO lighted super-buoy FI (5) Y 44°17'15.7"N 063°14'12.7"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-04)*

CANCELS subsurface mooring 44°17'15.6"N 063°14'12.6"W  
Caution note advertised on Chart 4320. See Notice 14-December-2007, DFO(6303647). Notice 6-July-2007(T), DFO(6303535) is now cancelled.

*DFO(6303535-05)*

SECTION 3 – Edition 12/2007  
CORRECTIONS TO RADIO AIDS TO MARINE NAVIGATION

CANADIAN COAST GUARD PUBLICATION – AMENDMENT TO THE RADIO AIDS TO MARINE NAVIGATION  
(ATLANTIC, ST-LAWRENCE, GREAT LAKES, LAKE WINNIPEG AND EASTERN ARCTIC) PUBLICATION 2007

Page 4-12

MARINE COMMUNICATIONS AND TRAFFIC SERVICES MESSAGE SERVICE

Message Charges

Delete section :

Messages subject to full international charges

Add

Messages no longer accepted:

- (a) Ships' business messages
- (b) Private messages

To" Messages handled without charge by MCTS Centres" section

Add:

- (j) Quarantine messages addressed to "Quarantine"
- (k) Messages requesting a doctor to meet a ship on arrival



**SECTION 4 – Edition 12/2007**  
**SAILING DIRECTIONS AND SMALL CRAFT GUIDE CORRECTIONS**

ATL 101 — Newfoundland — Northeast and East Coasts, First Edition, 1997 —

Chapter 1 — Paragraph 119 (Re: Correction promulgated in Monthly Edition No. 1/2006)

Add: A **light** (247.1) is shown from a mast on the outer end of the Public wharf.

(N2007-07.4)

ATL 102 — Newfoundland — East and South Coasts, First Edition, 1995 —

Chapter 1 — Paragraph 137, last line

Add: Starboard hand light **buoys** TSP2 and TSP4 (465.38, 465.39) mark the approach to the Public wharf.

(N2007-07.5)

Chapter 1 — Paragraph 356, line 2

Delete: NW

Replace by: NNW

(N2007-07.6)

Chapter 1 — Paragraph 356, line 4

Delete: 0.1 mile NNW

Replace by: 0.11 mile NW

(N2007-07.7)

Chapter 2 — Paragraph 45.1, line 1 – after “**pipeline**” (Re: Correction promulgated in Monthly Edition No. 4/1999)

Insert: with a least depth of 7.4 m (24 ft)

(N2007-07.8)

Chapter 2 — Paragraph 100, lines 6 to 9

Delete: “Several small ... channel.”

Replace by: A small wharf and slipway used by local boats is located at the NW end of the harbour. Entrance to the area is through a narrow shallow channel which is marked by starboard and port hand light **buoys** MR4, MR6 (515.53, 515.56) and MR3, MR5 (515.54, 515.55). A **light** (515.57) is shown from a mast on the east breakwater leading into the small boat wharf and slipway. A **light** (515.58) is shown from a mast on the outer end of the previously mentioned small wharf.

(N2007-07.9)

ATL 103 — Newfoundland — Southwest Coast, First Edition, 1995 —

Chapter 1 — Paragraph 138, line 9 – after “1.3 m (4 ft)”

Insert: and marked by port hand light **buoy** VJF1 (113.6)

(N2007-08.1)

ATL 108 — Gulf of St. Lawrence (Southwest Portion), First Edition, 2006 —

Chapter 4 — Paragraph 177, line 2

Delete: mouth of the river

Replace by: entrance of the fishing harbour

(Q2007-045.1)

ATL 109 — Gulf of St. Lawrence (Northeast Portion), First Edition, 2006 —

Chapter 3 — Paragraph 110, line 6 – after “entrance.”

Insert: Port and starboard hand light **buoys** XPP1 (203.2) and XPP2 (203.1) mark the entrance into Parsons Pond.

(N2007-08.0)

**SECTION 4 – Edition 12/2007**  
**SAILING DIRECTIONS AND SMALL CRAFT GUIDE CORRECTIONS**

ATL 111 — St. Lawrence River — Île Verte to Québec and Fjord du Saguenay, Third Edition, 2007 —

Chapter 4 — Paragraph 86, lines 4 and 5

Delete: “approximately ... wharf”

Replace by: south of the Powell wharf, immediately south of a wharf  
in ruins

(Q2007-047.1)

Chapter 4 — Paragraph 88, lines 2 and 3

Delete: “and a third ... *Consolidated*”

(Q2007-047.2)

CEN 301 — St. Lawrence River, Montréal to Kingston, First Edition, 1996 —

Chapter 1 — After paragraph 44

Insert: 45 Numerous depths, shoaler than those charted,  
may exist outside the St. Lawrence Seaway in the Lac  
Saint-Louis area. Mariners are warned to exercise caution  
when navigating in these waters.

(Q2007-046.1)

Small Craft Guide, Trent-Severn Waterway, Seventh Edition, 1989 —

INDEX — After “Lagoon City”

Delete: Laidlaw Point .....94

(C2007-044.01)

INDEX — Before “Omeme”

Delete: Oak Point .....47

(C2007-044.02)

INDEX — After “Thorah lock”

Delete: Thorne Island .....80

(C2007-044.03)

**SECTION 5 – Edition 12/2007**  
**LIST OF LIGHTS, BUOYS AND FOG SIGNALS CORRECTIONS**

No.	Name	Position		Light Characteristics	Focal Height in m. above water	Nominal Range	Description		Remarks
		Latitude N.	Longitude W.				Height in meters above ground	Fog Signals	

**NEWFOUNDLAND**

68.53	Burin Wharf	47 01 51.7 55 10 21.9	FI R	4s	3.0	.....	Cylindrical mast. 2.2	Year round.	<b>Chart:4616</b> <b>Edn 12/07(N07-054)</b>
80 H332	<b>Tête de Galantry (Fr.)</b>	46 45 56 56 09 17	FI(2) W	10s	48.3	22	White triangular tower, red upper portion. 18.0	Flash 0.1 s; eclipse 2.4 s; flash 0.1 s; eclipse 7.4 s. Year round.  <b>Horn</b> - Blast 2 s; sil. 3 s; blast 2 s; sil. 53 s.	<b>Chart:4643</b> <b>Edn 12/07</b>
327.8	Jackson's Cove Wharf	49 41 14 56 00 15	FI R	4s	4.0	2	Cylindrical mast. 2.1	Seasonal.	<b>Chart:4585</b> <b>Edn 12/07(N07-044)</b>
332.9	Long Island Ferry wharf	49 39 03 55 44 10.8	FI R	4s	4.0	2	Cylindrical mast. 2.1	Year round.	<b>Chart:4592</b> <b>Edn 12/07(N07-056)</b>
345	Point Leamington Wharf	At eastern end of wharf. 49 20 23.8 55 23 51.4	FI R	4s	3.4	4	Cylindrical mast. 2.1	Seasonal.	<b>Chart:4864</b> <b>Edn 12/07(N07-057)</b>
482.789	Harbour Grace Marina	47 40 23.4 53 14 26.5	FI R	4s	3.7	2	Cylindrical mast. 2.1	Year round.	<b>Chart:4849</b> <b>Edn 12/07(N06-117)</b>
515.57	Renews Breakwater	46 55 43.6 52 56 51.1	FI R	4s	4.0	2	Cylindrical mast. 2.1	Year round.	<b>Chart:4844</b> <b>Edn 12/07(N07-026)</b>

**ATLANTIC**

52.55	North Rock light buoy SA	44 59 56 66 52 44	FI(2) W	5s	.....	.....	Black, red horizontal band, marked "SA".	Year round.	<b>Chart:4124</b> <b>Edn 12/07 (F07-116)</b>
Nfld Light 80 H332	<b>Tête de Galantry (Fr.)</b>	46 45 56 56 09 17	FI(2) W	10s	48.3	22	White triangular tower, red upper portion. 18.0	Flash 0.1 s; eclipse 2.4 s; flash 0.1 s; eclipse 7.4 s. Year round.  <b>Horn</b> - Blast 2 s; sil. 3 s; blast 2 s; sil. 53 s.	<b>Chart:4643</b> <b>Edn 12/07</b>
230 H3864	Little River	On outer end of wharf. 44 26 37 66 07 45	F G	.....	7.0	7	Triangular skeleton tower. 6.6	Operates at night only. Year round.	<b>Chart:4118</b> <b>Edn 12/07 (F07-110)</b>

**SECTION 5 – Edition 12/2007**  
**LIST OF LIGHTS, BUOYS AND FOG SIGNALS CORRECTIONS**

No.	Name	Position ----- Latitude N. Longitude W.	Light Characteristics	Focal Height in m. above water	Nomi- nal Range	Description ----- Height in meters above ground	Remarks ----- Fog Signals
297.6	Pumpkin Ledge light buoy A6	Lobster bay, south approach lower argyle. 43 40 33.3 65 51 25.3	Fl R	4s	.....	Red, marked "A6".	Operates at night only. Year round.  Chart:4244 Edn 12/07 (F07-086)
324	Doctors Channel - West Cardinal light buoy NAC	SW. of S. end of Fish Island. 43 24 59.3 65 39 18.9	Q(9) W	15s	.....	Yellow, black and yellow, marked "NAC".	Year round.  Chart:4210 Edn 12/07 (F07-015, 083)
357.8	Strap Tub South Cardinal light buoy KSA	43 39 00 65 14 07.8	VQ(6) W +LFI	10	.....	Yellow and black spar, marked "KSA".	Year round.  Chart:4241 Edn 12/07 (F07-088)
386.01	Bantam Rock light buoy KA51	43 43 12 64 58 00	Fl G	4s	.....	Green, marked "KA51".	Year round.  Chart:4240 Edn 12/07 (F07-087)
417.81	Little Harbour Cherry Cove light buoy TU53	44 09 36.8 64 28 40.3	Fl G	4s	.....	Green spar, marked "TU53".	Year round.  Chart:4211 Edn 12/07 (F07-094)
419	Little Harbour Cherry Cove light buoy TU54	44 09 37.7 64 28 48.2	Fl R	4s	.....	Red spar, marked "TU54".	Year round.  Chart:4211 Edn 12/07 (F07-097)
426.5	Cockawee Shoal light buoy T54/2	44 15 41.8 64 21 26.3	Fl R	4s	.....	Red spar, marked "T54/2".	Year round.  Chart:4395 Edn 12/07 (F07-109)
427	Cockawee Shoal West light buoy T56	W. of shoal. 44 15 50.6 64 21 32.8	Fl R	4s	.....	Red, marked "T56".	Year round.  Chart:4394 Edn 12/07 (F07-101)
467 H3674	New Harbour	On S. side of entrance. 44 28 21.3 64 05 32.2	Fl R	5s	7.8	4 Triangular skeleton mast. 6.8	Operates at night only. Year round.  Chart:4381 Edn 12/07 (F07-095)
860.8 H1176	Pleasant Bay Main						Delete from list.  Chart:4464 Edn 12/07 (G07-155)
900.7	Pictou Harbour light buoy SJ1						Delete from List.  Chart:4437 Edn 12/07 (G07-169)
973 H964	Wood Islands Harbour range						Delete from list
974 H964.1							Chart:4483 Edn 12/07 (G07-152, 149)

**SECTION 5 – Edition 12/2007**  
**LIST OF LIGHTS, BUOYS AND FOG SIGNALS CORRECTIONS**

No.	Name	Position ----- Latitude N. Longitude W.	Light Characteristics	Focal Height in m. above water	Nomi- nal Range	Description ----- Height in meters above ground	Remarks ----- Fog Signals
1027.43	Egmont Bay North light buoy DJ20	46 33 16.8 64 05 10.2	Fl R	4s	.....	Red, marked "DJ20".	Seasonal.  <b>Chart:4905</b> <b>Edn 12/07 (G07-132)</b>
1044 H1164	St. Peters						Delete from list.  <b>Chart:4425</b> <b>Edn 12/07 (G07-172)</b>
1045	St. Peters Harbour range						Delete from list.
1046							<b>Chart:4425</b> <b>Edn 12/07 (G07-145, 147)</b>
1163 H1424	Point Escuminac	On point. 47 04 22.5 64 47 52.3	Fl(3) W	20s	22.0 13	White hexagonal tower, red upper portion. 22.4	Flash 1 s; eclipse 1 s; flash 1 s; eclipse 1 s; flash 1 s; eclipse 15 s. Obscured from 110° to 120°. Year round.  Horn - Blast 3 s; sil. 3 s; blast 3 s; sil. 51 s.  <b>Chart:4911</b> <b>Edn 12/07 (G07-168)</b>
1264.7 H1552	Miscou Island <b>Racon -- (K)</b> <b>X &amp; S Band</b>	On Birch point. 48 00 33.7 64 29 34.7	Oc W	5s	24.5 10	White octagonal tower. 25.3	Flash 4 s; eclipse 1 s. Year round.  <b>Chart:4486</b> <b>Edn 12/07 (G07-167)</b>
1546 H1891.2	Baie de Tabatière Outer range	On shore line. 50 50 36.1 58 58 28.7	F G	.....	43.8 14	Skeleton tower, orange daymark, black vertical stripe. 31.2	Visible in line of range. Operates at night only. Year round.
1547 H1891.3		234°46' 143.5 m from front.	F G	.....	51.6 15	Square skeleton tower, orange daymark, black vertical stripe. 4.8	Visible in line of range. Operates at night only. Year round.  <b>Chart:4474</b> <b>Edn 12/07 (Q07-136, 137)</b>
2019 H2356	Calvaire range	W. of Cap Charles. 46 33 22 72 05 10.9	F G	.....	39.8 17	Square skeleton tower, orange slatwork daymark, black vertical stripe. 9.1	Visible in line of range. Emergency light. Year round.
2020 H2356.1		238°29' 615.8m from front.	F G	.....	54.2 17	Square skeleton tower, orange slatwork daymark, black vertical stripe. 20.5	Visible in line of range. Emergency light. Year round.  <b>Chart:1314</b> <b>Edn 11/07 (Q07-097, 114)</b>

**SECTION 5 – Edition 12/2007**  
**LIST OF LIGHTS, BUOYS AND FOG SIGNALS CORRECTIONS**

No.	Name	Position ----- Latitude N. Longitude W.	Light Characteristics	Focal Height in m. above water	Nomi- nal Range	Description ----- Height in meters above ground	Remarks ----- Fog Signals		
<b>ATLANTIC</b>									
2288 <i>H2454</i>	Petite Traverse range	On E. bank.	F	G	.....	16.8	14	Cylindrical tower, orange slatwork daymark, black vertical stripe. 7.0	Visible in line of range. Night emergency light. Visible from 045°30' through E. to 164°30'. Year round.
		45 54 40.1 73 12 29.1	F	G	.....	16.4	6		
2289 <i>H2454.1</i>	Petite Traverse range	045°43' 517.2m from front.	F	G	.....	31.9	14	Square skeleton tower, orange slatwork daymark, black vertical stripe. 20.5	Visible in line of range. Night emergency light. Visible from 360°. Year round.
			F	G	.....	31.6	6		
<b>Chart:1311 Edn 12/07 (Q07-125)</b>									
2315 <i>H2472</i>	Contrecoeur- Verchères range	On pier, Contrecoeur Islands.	F	G	.....	9.4	14	Square tower, orange slatwork daymark, black vertical stripe. 4.1	Visible in line of range. Operates at night only. Year round.
		45 51 54.9 73 15 06.7							
2316 <i>H2472.1</i>	Contrecoeur- Verchères range	040°23' 1273.8m from front.	F	G	.....	18.8	14	Red and white square tower, orange slatwork daymark, black vertical stripe. 14.4	Visible in line of range. Operates at night only. Year round.
			Iso	G	2s	18.8	4		
<b>Chart:1311 Edn 12/07 (Q07-138, 139)</b>									
<b>INLAND WATERS</b>									
285.5	Toussaint Island West	44 48 41.9 75 19 57.2	Iso	R	2s	8.8	5	White cylindrical mast, red upper portion. 7.8	Seasonal.
<b>Chart:1434 Edn 12/07(B07-055)</b>									
324	McCoy Island 141	On N. side of island. 44 34 04.6 75 42 10.5	Q	G	1s	9.1	3	White cylindrical mast, green upper portion, marked "141". 7.0	Seasonal.
<b>Chart:1435 Edn 12/07(B07-054)</b>									
329	Stovin Island 145	On island. 44 33 33.8 75 42 53.5	Fl	G	4s	10.3	4	White cylindrical mast, green upper portion, marked "145". 6.1	Seasonal.
<b>Chart:1435 Edn 12/07(B07-053)</b>									
712	Thames River range	42 19 04.9 82 27 13	Iso	R	4s	8.8	6	White cylindrical tower, orange triangular daymark, black vertical stripe. 7.1	Seasonal.
713		147° 54.3m from front.	F	R	.....	16.0	11	White cylindrical tower, red upper portion. 16.5	Seasonal.
<b>Chart:14850(U.S.) Edn 12/07(B07-056)</b>									

**SECTION 5 – Edition 12/2007**  
**LIST OF LIGHTS, BUOYS AND FOG SIGNALS CORRECTIONS**

No.	Name	Position ----- Latitude N. Longitude W.	Light Characteristics	Focal Height in m. above water	Nomi- nal Range	Description ----- Height in meters above ground	Remarks ----- Fog Signals
-----	------	--	--------------------------	--	-----------------------	--	---------------------------------

**INLAND WATERS**

839.1	Meaford Firing Range Cautionary light buoy TMA	44 44 39.9 80 46 21.7	Fl Y 4s	.....	.....	Yellow spar, marked "TMA".	Owned by the Department of National Defence. Winter spar. Seasonal.	
							<b>Chart:2283</b> <b>Edn 12/07(D07-046)</b>	
839.11	Meaford Firing Range Cautionary light buoy TMC	44 44 39.9 80 41 49.6	Fl Y 4s	.....	.....	Yellow spar, marked "TMC".	Owned by the Department of National Defence. Winter spar. Seasonal.	
							<b>Chart:2283</b> <b>Edn 12/07(D07-048)</b>	
839.12	Meaford Firing Range Cautionary light buoy TME	44 44 25.4 80 37 17.2	Fl Y 4s	.....	.....	Yellow spar, marked "TME".	Owned by the Department of National Defence. Winter spar. Seasonal.	
							<b>Chart:2283</b> <b>Edn 12/07(D07-050)</b>	
1111	Slate Islands	On S. extremity of Patterson Island. 48 37 16 86 59 45	Fl(2) W	15s	68.3	9	White octagonal tower. 10.5	Flash 0.5s; eclipse 4.5 s; flash 0.5.; eclipse 9.5 s. Seasonal.
							<b>Chart:2303</b> <b>Edn 12/07(D07-054)</b>	
1809.6	Mile 978.2 – Dillon Channel range	On W. shore, N. of Kasook Channel entrance. 68 21 55 134 12 18	F W	.....	9.1	14	Square skeleton tower, red daymark, white vertical stripe.	Visible in line of range. Seasonal.
1809.7		250° 102.1m from front.	F W	.....	15.2	14	Square skeleton tower, red daymark, white vertical stripe.	Visible in line of range. Seasonal.
							<b>Chart:6428</b> <b>Edn 12/07(A07-034,035)</b>	

**CANADIAN COAST GUARD  
MARINE INFORMATION REPORT AND SUGGESTION SHEET**

Date: .....

Name of Ship or Sender:.....

Address of Sender: .....

Street #

Street Name

Town / City:..... Prov / State: ..... Postal Code / Zip Code: .....

Tel / Fax / E-mail address of sender (if appropriate): .....

Observation Date: ..... Time (UTC): .....

Geographical Position:.....

Coordinate Position: Lat: ..... Long:.....

Position Method:      DGPS      GPS with WAAS      GPS      Radar      Other

Horizontal Datum Used:            WGS 84            NAD 27      Other

Estimated Position Accuracy:.....

Chart #: ..... Datum:      NAD 27      NAD 83

Chart Edition: ..... Last Correction applied: .....

Publications affected: (Quote Volume and page):.....

\*Full details (Attach additional sheets as necessary) ... ..

Mariners are requested to notify the responsible authorities when new or suspected dangers to navigation are discovered, changes are observed in aids to navigation, or corrections to publications are seen to be necessary.

*In the case of new or suspected dangers to navigation, it is important that all details be given in order to aid with future investigations. Items of interest include heights, depths, physical description, type of bottom and equipment method used to position the item. It is helpful to mark details on chart, which will be promptly replaced by the Canadian Hydrographic Service.*

Reports should be made to the nearest Marine Communications and Traffic Services Centre (MCTS) and should be confirmed in writing to:

Director, Navigation Systems  
Canadian Coast Guard  
Department of Fisheries and Oceans  
Ottawa, Ontario, K1A 0E6

In the case of information concerning aids to navigation or the List of Lights, Buoys and Fog Signals.

**OR**

Dominion Hydrographer  
Canadian Hydrographic Service  
Department of Fisheries and Oceans  
Ottawa, Ontario, K1A 0E6

In the case of new or suspected dangers to navigation or where corrections to "Sailing Directions" appear to be necessary.

[CHSINFO@DFO-MPO.GC.CA](mailto:CHSINFO@DFO-MPO.GC.CA)

Or general questions on Coast Guard programs or services please send an e-mail message to:

[info@dfo-mpo.gc.ca](mailto:info@dfo-mpo.gc.ca)

(Please include your postal code and e-mail address)